

# Work Order ID 59027

Tuesday, May 25, 2010 8:21:38 AM



Page 1

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 5/25/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 6/10/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

*[Signature]*

Date: 5-25

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-141	Rev D								

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D212-664-101 CHG003

*Solobetz*

110

0.00



Pick Kit

Packaging

Memo

0.00

Packaging

Packaging

*(IX) MB 10-06-14*

120

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

*(IX) MB 10-06-14*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM



Page 2

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 5/25/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 6/10/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

130

QC15- Crosstube Dimensional Check

0.00



QC

Memo

0.00

8 10/6/14

40

Quality Control

140

Crosstubes

0.00



Crosstubes

Memo

0.00

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 &amp; DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 &amp; DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

4-Deburr &amp; Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

MB 10-06-14  
MB 10-06-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM

Page 3

Item ID: D212-664-101

Accept

Revision ID:

Item Name: Crosstube Fwd

Start Date: 5/25/2010 Start Qty: 1.00

Required Date: 6/10/2010 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Chemical Conversion Coat within 24 hours of bending and drilling

1 - - AWM 10-06-13

160

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

8/10/15

Ⓢ

170

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 038  
Issue P/O: 12/21  
LPI as per ASTM 1417 Level 2  
Attach copy of NDT results to work order

CZ 10/01/13 Ⓢ

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM



Page 4

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 5/25/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 6/10/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

180



Packaging

Receive & Inspect for Damage & Mat'l Certs  
Packaging

0.00

Memo

0.00

Packaging

Ensure copy of NDT results attached to work order.

*P060/e/18 C*

190



QC

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

Quality Control

Inspect for damage &amp; ensure results are as per Dwg D212-664-141

*MA 10 06 21 0*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM



Page 5

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 5/25/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 6/10/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

200

Spray Painting per QSI005 4.2

0.00



SprayPaint

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2  
2-Paint outside crosstube with White Imron as per QSI 005 4.2

PRIME:

Start Time: 9:30

Finish Time: 10:30

PAINT:

Start Time: 3:00

Finish Time: 4:30

ml 10 06 21 ①

210

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

IT 10-06 22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM

Page 6

Item ID: D212-664-101

Accept

Setup Start

Revision ID:

Item Name: Crosstube Fwd

Stop

Start Date: 5/25/2010 Start Qty: 1.00

Required Date: 6/10/2010 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

220

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond Batch: 114021

Tongue ml 10-06-23

exp. 01/2011

230

0.00



QC

QC5- Inspect part completeness to step on W/O

Memo

0.00

Quality Control

240

0.00



Packaging

Pick Kit

Memo

0.00

Packaging

ml 10 06 22 ①

④

P/L 10/24 ②

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 59027**

Tuesday, May 25, 2010 8:21:38 AM



Page 7

Item ID: D212-664-101

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 5/25/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 6/10/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

250

QC4- 100% Inspect kits for completeness

0.00



QC

Memo

0.00

8/10/06/24

10

Quality Control

260

Packaging

0.00



Packaging

Memo

0.00

N.E.U.

Packaging

Identify and pack for shipping as per PPP D212-664-101

10/06/24

270

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

10/06/24

Quality Control

CY 10/06/24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Tuesday, May 25, 2010 8:21:42 AM

Page 1

Work Order ID: 59027

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Comments: IPP Rev:E 04.02.16 Reformat KJ/DS  
IPP Rev:F 06-03-29 Remove Comments on Pick List JLM  
IPP Rev:G 07-04-30 As per Rev C JLM

Start Date: 5/25/2010

Required Date: 6/10/2010

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Qty per Kit	Total	Qty	Date	Status
D212-664-101TRN		Manufactured	No			110	Each	2.0000	1	1			



Crosstube Turning Detail



MB 10-06-10

Location	Loc Qty	Loc Code
----------	---------	----------

LG	2	
58655	1	
58656	1	

D3595-063-450 Manufactured No



RUBBER CUSHION

230 Each 54.5790



4.210526

Location	Loc Qty	Loc Code
----------	---------	----------

LG	54.57897368	
53775	26.5789737	
58161	28	

MS21920-25 Purchased No



Clamp(per MIL-DTL-8783C)

220 Each 69.0000



4

Location	Loc Qty	Loc Code
----------	---------	----------

ST451	69	
113281	25	
113282	18	
113744	1	
114141	25	

B# 114759

m/ 10.06.22

m/ 10.06.22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Tuesday, May 25, 2010 8:21:42 AM

1994, 1995, 1996, 1997, 1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 26

[REDACTED]

**Required Date:** 6/10/2010

**Required Qty: 1.00**

[illegible]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Tuesday, May 25, 2010 8:21:42 AM

Page 3

Work Order ID: 59027



Parent Item: D212-664-101



Parent Item Name: Crosstube Fwd

Start Date: 5/25/2010

Required Date: 6/10/2010

Comments: IPP Rev:E 04.02.16 Reformat KJ/DS  
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM  
IPP Rev:G 07-04-30 As per Rev C JLM

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Qty per Kit	Total	Qty	Date	Status
--------------------	-------------	------	-----	---------	------	-------	---------	--------	-------------	-------	-----	------	--------

MS21042L6

Purchased

No

240

Each

351.0000

6

6

Nut

## Location

## Loc Qty

## Loc Code

ST300

351

111578

151

114495

200

AN960JD616

NAS1149D0663J

Purchased

No

240

Each

0.0000

18

18

Washer

111578

1114348 6/10/2010 ①

Tuesday, May 25, 2010 8:21:42 AM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	59027
<b>Description:</b> Crosstube High Fwd (205/212/412)		<b>Part Number:</b>	D212-664-101
<b>Inspection Dwg:</b> D212-664-141 <b>Rev:</b> D		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

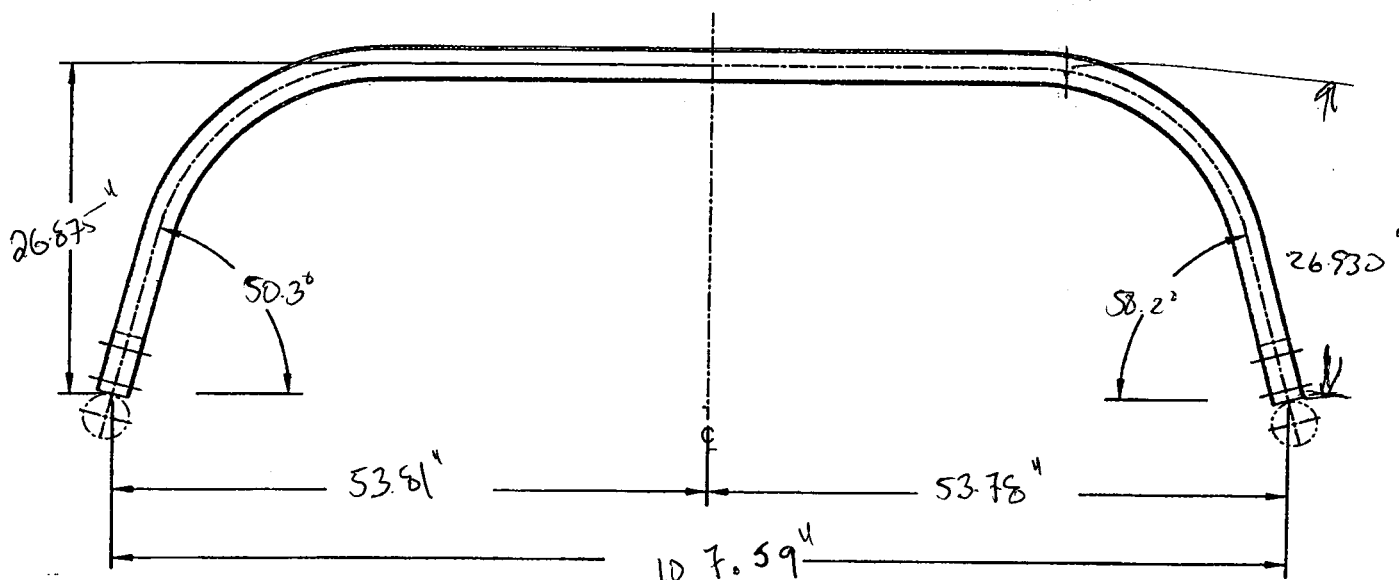

Comments

QC15 Inspection	8
Date	10/6/14

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128  
FINISHED LENGTH = 126.514±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)  
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 59027  
Bj10-5-25

RELEASED  
2009-10-29  
N/A

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



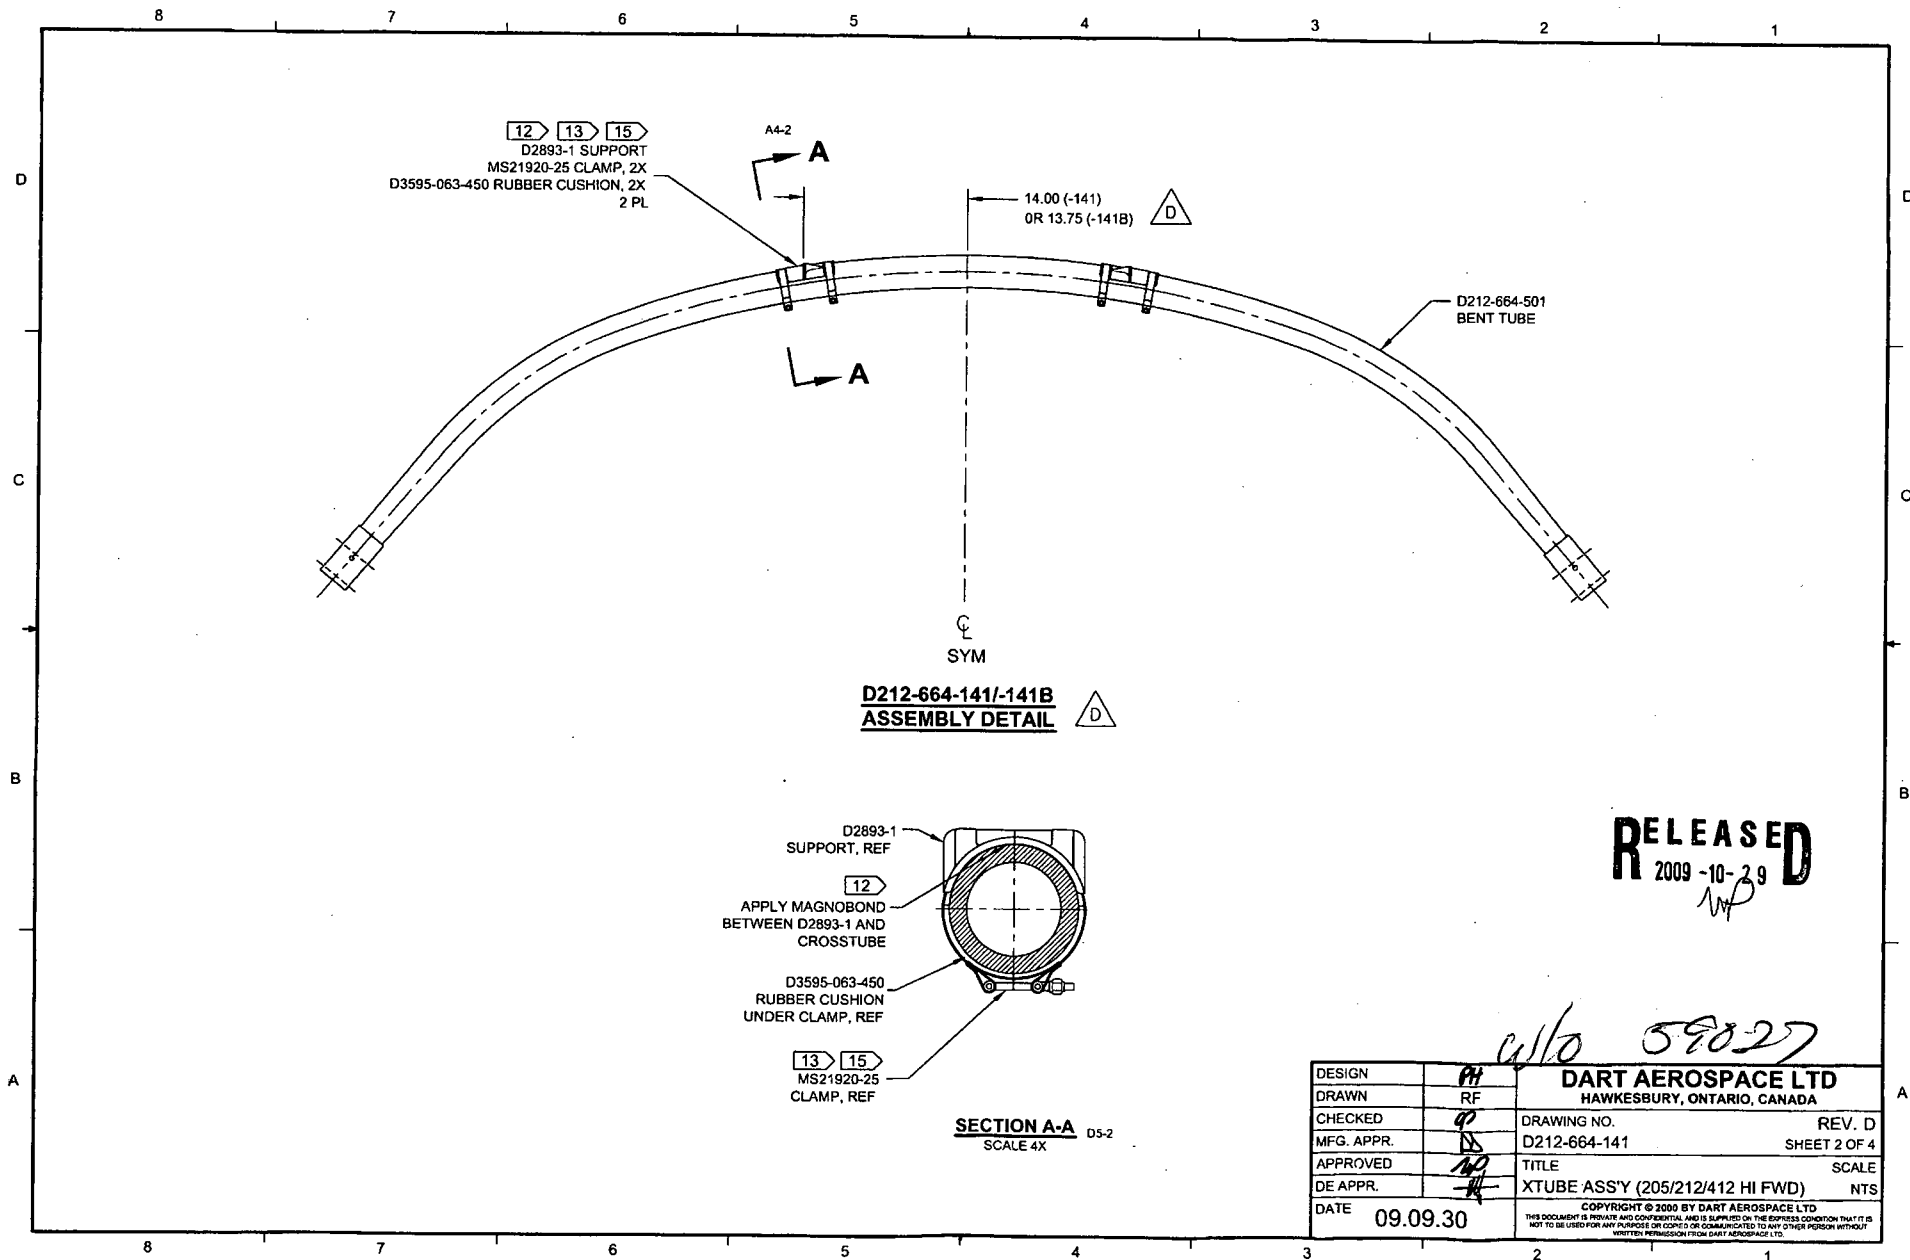

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**D212-664-501**  
**BENDING AND DRILLING DETAIL**

10 D

**RELEASED**  
 2009-10-29  
*MP*




*01659027*

**DART AEROSPACE LTD**  
 HAWKESBURY, ONTARIO, CANADA

DESIGN	<i>PH</i>	DRAWING NO. D212-664-141	REV. D SHEET 3 OF 4
DRAWN	RF		
CHECKED	<i>Q</i>	TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE NTS
MFG. APPR.	<i>AS</i>		
APPROVED	<i>MP</i>	DATE 09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.
DE APPR.	<i>MP</i>		

**VIEW C-C: CUFF DETAIL** C2-3  
 SCALE 3X

**SECTION B-B** C4-3  
 SCALE 4X

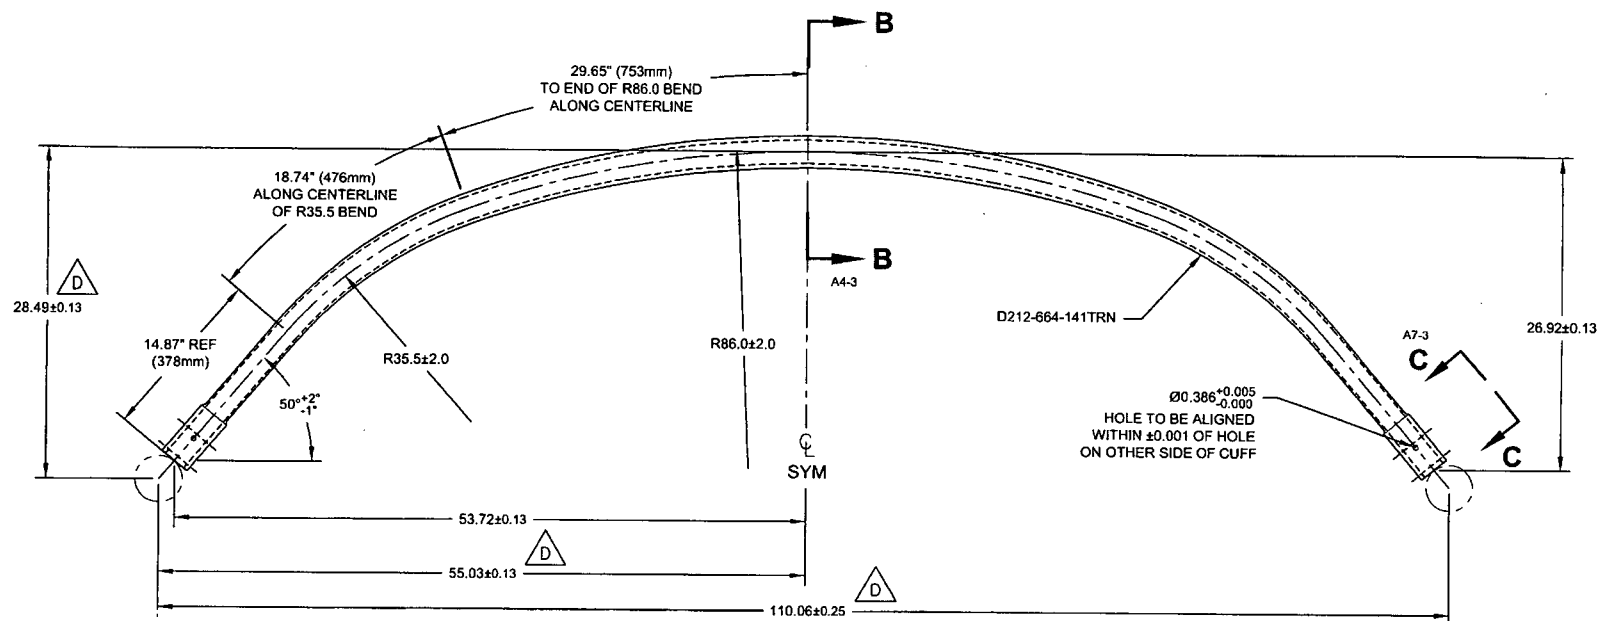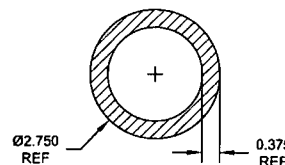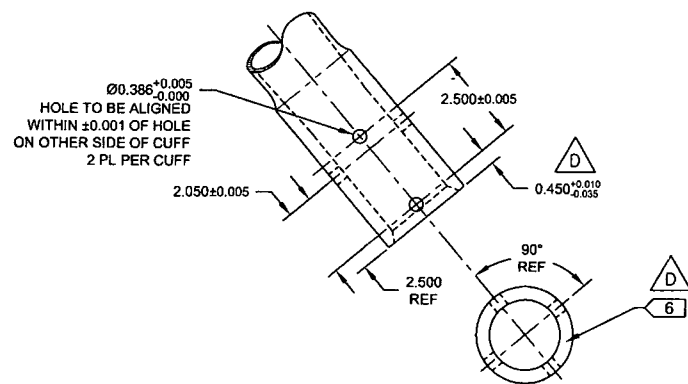


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

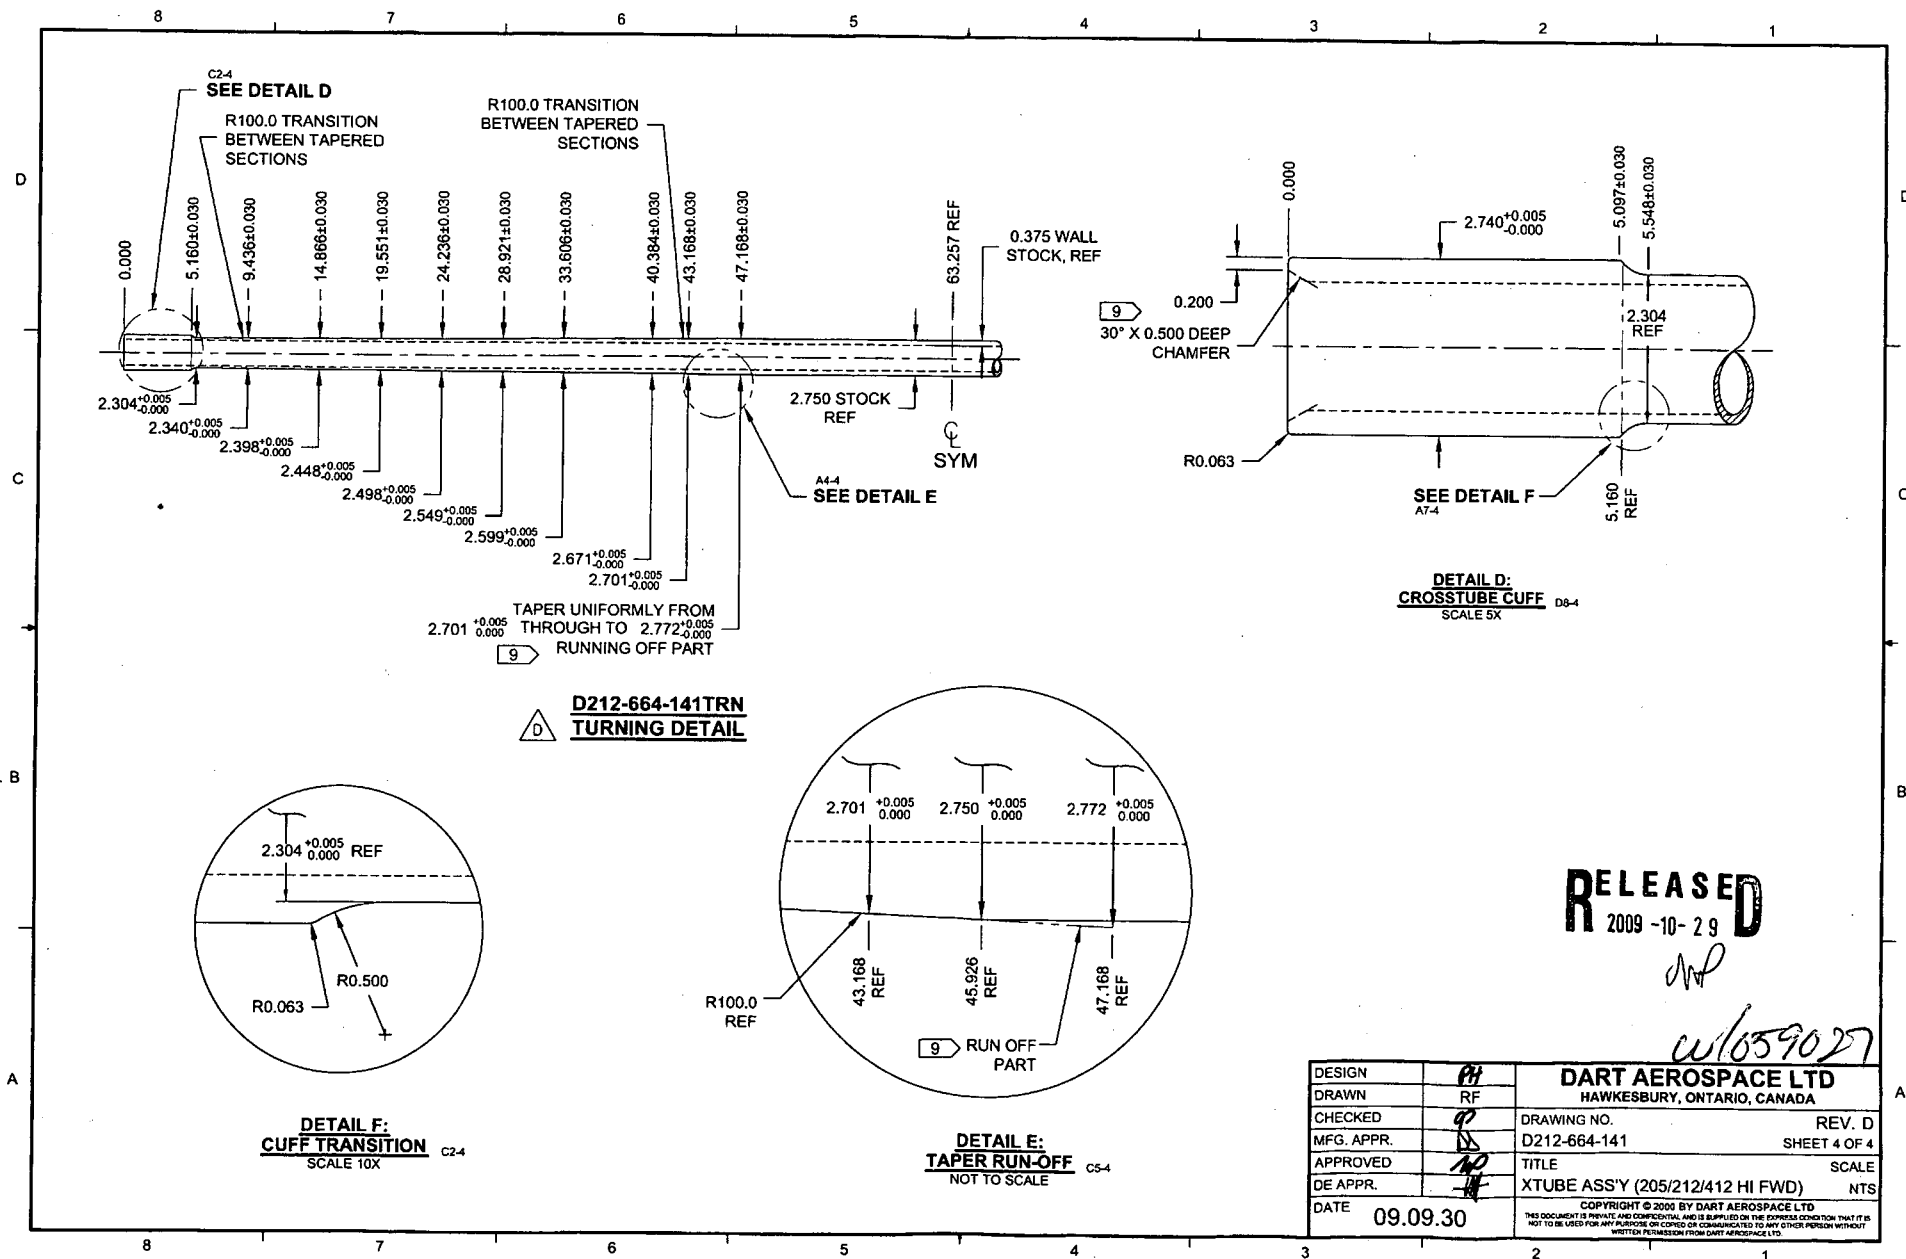

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

## 5.0 PARTS LIST

## 5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
31			2	* D2856-600-1009	ABRASION STRIP
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

\*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/241 OR D412-664-243 ASSEMBLIES ABOVE  
NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AA  
SKIDTUBES.

• COPYRIGHT © 2001 BY DART AEROSPACE LTD. •  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED  
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: F  
Date: 08.09.05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries





## LIQUID PENETRANT TEST REPORT

P- 15326

CLIENT	DART Aerospace	DATE	JUNE 18-2010	PAGE	1	OF	1	
ATTENTION	LINDA	ACUREN JOB NO.	188-10-0769	TIME	AM	<input checked="" type="checkbox"/>	PM	<input type="checkbox"/>
ADDRESS	1270 ABERDEEN ST. HAWKESBURY ON. K6H 1K7	POWOW NO.	12121	WORK LOCATION	MAIN SHOP - HAWKESBURY			
PROJECT	F.P.I. ON CROSS TUBES AND MACHINED PARTS							
ITEM(S) EXAMINED	5 - CROSS TUBES 57 - MACHINED PARTS							

JOB DESCRIPTION	PROCEDURE NO. LT-0002	REV./DATE	-	TECHNIQUE NO. LT-TECH2	REV./DATE	-
PART NO.	-			MATERIAL	ALUMINUM THICKNESS VARIOUS	
SCOPE	WET FLUORESCENT LIQUID PENETRANT INSPECTION CARRIED OUT 100% EXTERNAL					

TEST DETAILS	
METHOD	<input checked="" type="checkbox"/> FLUORESCENT <input type="checkbox"/> VISIBLE
FAMILY BRAND	MAGNA FLUX
PENETRANT	2L 67 MINIMUM DWELL TIME 45 MIN.
PENETRANT REMOVER	170 MINIMUM DRY TIME >10 MIN.
DEVELOPER	SAD 52 MINIMUM DWELL TIME 10 MIN.
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS <input type="checkbox"/> AQUEOUS <input type="checkbox"/> DRY
WATER WASH <input checked="" type="checkbox"/> SOLVENT REMOVABLE <input type="checkbox"/> POST EMULSIFIED	
BLACK LIGHT S/N 16459 OUTPUT > 1000 $\mu$ W/cm <sup>2</sup> AMBIENT < 2 fc	
LIGHTING EQUIP. <input type="checkbox"/> FLASHLIGHT <input type="checkbox"/> TROUBLELIGHT OUTPUT > 100 fc @ SURFACE	
OTHER LABINO	
LIGHT METER S/N 1098866 CAL DUE DATE OCT-19-2010	

TEST SURFACE	
SURFACE CONDITION	<input type="checkbox"/> AS GROUND <input type="checkbox"/> AS WELDED <input checked="" type="checkbox"/> MACHINED <input type="checkbox"/> SHOT BLASTED <input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < -4°C/ 20°F <input type="checkbox"/> -4°C/ 20°F TO 10°C/ 50°F <input checked="" type="checkbox"/> 10°C/ 50°F TO 52°C/ 125°F <input type="checkbox"/> > 52°C/ 125°F

RESULTS- ( <input type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL )
1 - W.O. 59047 - CROSS TUBE ✓
1 - W.O. 59026 - CROSS TUBE ✓
1 - W.O. 59027 - CROSS TUBE ✓
1 - W.O. 59278 - CROSS TUBE ✓
1 - W.O. 59279 - CROSS TUBE ✓
37 - W.O. 58631 - STUDS ✓
20 - W.O. 58634 - SLEEVE'S ✓
10-06-21

## Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

## Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE	JASON MURDOCH	DTR #	E27415
TECHNICIAN (SIGNATURE):	Mike Selters	REPORT REVIEWED BY:	
NAME (PRINT):	Mike Selters	NAME	INITIALS
CGSB LEVEL	II	CGSB LEVEL	
CGSB REG. NO.	6606	CGSB REG. NO.	